

Product Information L-Cell®

FOOD

Bolt-on Weighing Cell L-Cell®

Application/Specified usage

- Extremely long-lasting, reliable and compact dual-axis bolt-on strain gauge sensors
- For all types of vessels with a leg support structure or mounted on horizontal beams, and for skirted silos
- · Level control through dynamic, continuous and accurate weight measurement
- The technology avoids measurement inaccuracies caused by the angle of repose, rat-holing, bridging, moisture content, compaction etc.
- Integrated strain gauges transmit stress changes in the metal caused by any fluctuations in the container contents, as a measuring signal to the control system
- With a fatigue life of > 20 million measuring cycles, high shock resistance, and weather insensitivity, L-Cell® is virtually "indestructible" for almost all applications.

Application Examples

- · Precise inventory measuring systems for all types of single or multiple containers
- · For metal substructures or skirted silos
- · For outdoor and indoor applications
- · From 35 t total load (vessel plus contents)
- · Mounting on structural profiles, horizontal shear beams, or skirts
- · Retrofitting and calibration possible at any filling level

Features

- Durable, reliable measurement: Kistler-Morse pioneered bolt-on technology for storage vessels and silos. This method is still the standard way of measuring load-induced strain for precise quantity measurement in bulk vessels in many markets
- Simple installation, even for retrofitting: Using the installation set and drilling template, the sensors are simply bolted to the structural supports or skirts and connected to the controller via a junction box. There is no need to empty, lift or modify the vessel
- · Easy calibration: An empty vessel is not required. Precise calibration can take place at any fill level
- · Easy to replace: If damaged due to e.g. mechanical impact, sensors can be easily replaced on-site
- · Half-Bridge Strain Gauge Technology
- The L-Cell's exclusive Standardized Axial Strain Sensitivity (SASS®) provides active temperature compensation over a wide temperature range

Options/Accessories


- · ATEX Approval
- · Junction boxes for up to 4 sensors
- · Controllers for 1 to 120 vessels

Communication

10...30 V DC




Typical L-Cell installation on different types of vessel structures

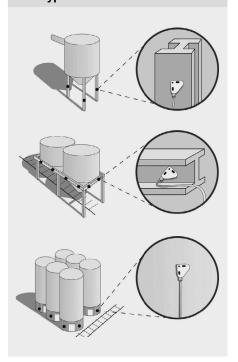


FOOD Specification


2

Specification	
Excitation Voltage Excitation Current Strain Gauge to Sensor Frame Breakdown Voltage Stress Level	12 (± 5 % VDC) 12 V: 4.0 mA at -18 °C (0 °F) to 2.7 mA at 30 °C (100 °F) > 250 VDC Carbon structures: Maximum: ± 15,000 psi (10.5 kg/mm²) Recommended: 5,000 ± 3,500 psi (3.5 ± 2.5 kg/mm²) Aluminium structures: Maximum: ± 6,500 psi (4.6 kg/mm²) Recommended: 3,000 ± 1,500 psi (2.1 ± 1.1 kg/mm²)
Fatigue Life	> 20 million cycles; load & unload at 0 to 7,500 psi (0 to 5.3 kg/mm²)
Output Sensitivity Zero Strain Output Output Impedance Sensitivity Change Zero Shift	Carbon Steel: $35 \text{ mV} \pm 1 \text{ \%/1,000 psi}$ ($35 \text{ mV} \pm 1 \text{ \%/0.7 kg/mm}^2$) Aluminum: $80 \text{ mV} \pm 1 \text{ \%/1,000 psi}$ ($80 \text{ mV} \pm 1 \text{ \%/0.7 kg/mm}^2$) $0 \text{ mV} \pm 100 \text{ mV}$ $3.75 \text{K } \Omega \left(\pm 1 \text{ \%}\right)$ $0.02 \text{ \% per degree F}$ ($0.036 \text{ \% per degree C}$) over the compensated range 2 mV between -18 and 38 °C (0 and 100 °F)
Operational Temperature range Storage Temperature range Compensated Temperature range	-3466 °C (-30150 °F) -3466 °C (-30150 °F) -1838 °C (0100 °F)
Cable	3-conductor, 22 gauge, unshielded (15" (4.6 m))
Authorizations	ATEX (optional)

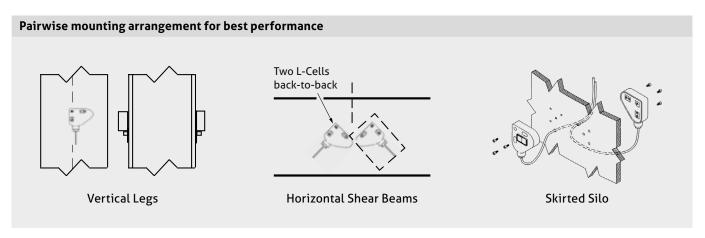

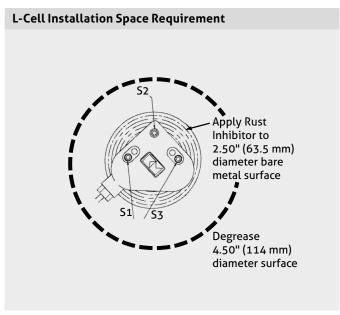


L-Cell Mounting Location on Vertical Legs (example)

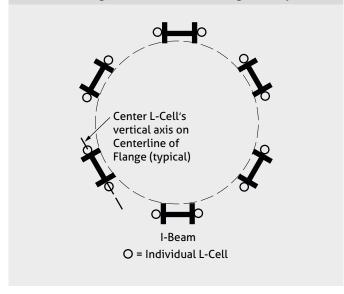

Note:

For more mounting options please refer to the L-Cell installation and operating manual or contact the Anderson-Negele support.

L-Cell Mounting Location on Horizontal Shear Beams (example)

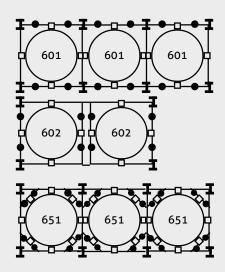

= Individual L-Cell (Standard performance) or Pairwise L-Cell (Best performance)

Transport/Storage



- · Do not store outside
- · Store in an area that is dry and dust-free
- · Do not expose to corrosive media
- · Protect against solar radiation
- · Avoid mechanical shock and vibration
- Storage temperature -34...66 °C (-30...150 °F)
- · Relative humidity max. 98 %

Conventional usage

Nataritalia famana

Standards and guidelines



 Not suitable for applications in safety-relevant system parts (SIL).

Cleaning/Maintenance



 When using a pressure washer, do not point the nozzle directly at the electrical connections.



Compliance with the applicable regulations and directives is mandatory.

Reshipment



- Sensors shall be clean and free of media or heatconductive paste and must not be contaminated with dangerous media!
- · Use suitable transport packaging only to avoid damage of the equipment!

Note on CE




- · Applicable directives:
- Electromagnetic Compatibility Directive 2014/30/EU
- Compliance with the applicable EU directives is identified by the CE label on the product.
- The operating company is responsible for complying with the guidelines applicable to the entire installation.

Disposal



- Electrical devices should not be disposed of with household trash. They must be recycled in accordance with national laws and regulations.
- Take the device directly to a specialized recycling company and do not use municipal collection points.

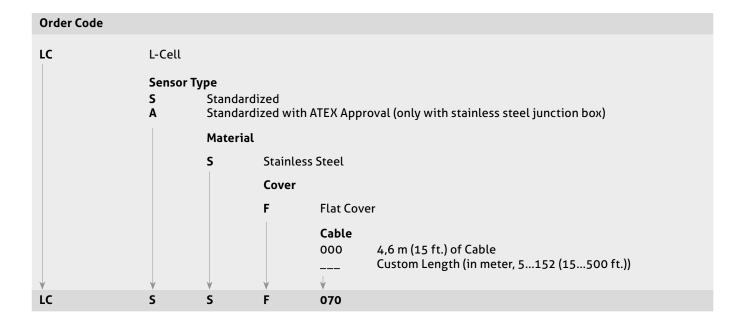

Accessories

One cable 3-conductor, unshielded, is supplied with each Microcell

JB-S-P1 JB-S-P2	Junction Box Half Bridge, Plastic, 1 hole entry Junction Box Half Bridge, Plastic, 2 hole entry
JB-S-A4	Junction Box Half Bridge, Aluminium, 4 hole entry
JB-S-S1	Junction Box Half Bridge, Stainless Steel, 1 hole entry
JB-S-S2	Junction Box Half Bridge, Stainless Steel, 2 hole entry

